TROUBLESHOOTING

PROBLEM SYMPTOMS TABLE

IGNITION SWITCH AND KEY UNLOCK WARNING SWITCH

Symptom	Suspected Area	See page
Ignition switch is not set to each position.	11. Ignition switch	BE-14
"Key unlock warning system" does not operate.	1. GAUGE fuse	BE-10
	2. Key unlock warning switch	BE-14
	3. Door courtesy switch	BE-24
	4. Wire harness	_

w/ Daytime Running Light System: HEADLIGHT AND TAILLIGHT SYSTEM

Symptom	Suspected Area	See page
	Headlight dimmer switch	BE-17
	2. Light control switch	BE-17
	3. Headlight control relay	BE-17
	4. Daytime running light relay	BE-17
Headlight does not light. (Taillight is normal.)	5. Headlight dimmer relay	BE-17
	6. Daytime running light No. 4 relay	BE-17
	7. Body ECU	DI-768
	8. Headlight bulb	_
	9. Wire harness	_
	1. Headlight dimmer switch	BE-10
	2. Light control switch	BE-17
	3. Headlight control relay	BE-17
Headlight does not light. (Taillight does not light up.)	4. Daytime running light relay	BE-17
Treadilght does not light. (railinght does not light up.)	5. Headlight dimmer relay	BE-17
	6. Daytime running light No. 4 relay	BE-17
	7. Headlight bulb	-
	8. Wire harness	_
	1. HEAD fuse (HI LH, HI RH, LO LH, LO RH)	BE-10
Only one side light does not light.	2. Headlight bulb	_
	3. Wire harness	_
	1. HEAD fuse (LO LH, LO RH)	BE-10
	2. Headlight dimmer switch	BE-17
"Lo-beam" does not light. (All)	3. Headlight dimmer relay	BE-17
	4. Headlight bulb	_
	5. Wire harness	_
	1. HEAD fuse (LO LH, LO RH)	BE-10
"Lo-beam" does not light. (One side)	2. Headlight bulb	_
	3. Wire harness	_
	1. HEAD fuse (HI LH, HI RH)	BE-10
	2. Headlight dimmer switch	BE-17
"Hi-beam" does not light. (All)	3. Headlight dimmer relay	BE-17
	4. Headlight bulb	_
	5. Wire harness	
	1. HEAD fuse (HI LH, HI RH)	BE-10
"Hi-beam" does not light. (One side)	2. Headlight bulb	_
	3. Wire harness	
	Headlight dimmer switch	BE-17
"Flash" does not light.	2. Wire harness	_
	Light control switch	BE-17
Headlight does not light with light control switch in HEAD.	Wire harness	-

2003 TOYOTA TACOMA (RM1002U)

Headlight does not go out with light control switch in OFF.	Light control switch Wire harness	BE-17 -
Taillight does not light with light control switch in TAIL.	Taillight control relay TAIL fuse Light control switch Wire harness	BE-17 BE-10 BE-17
Taillight does not go out with light control switch in OFF.	Taillight control relay TAIL fuse Light control switch Wire harness	BE-17 BE-10 BE-17
Headlight does not light with engine running and light control switch in OFF.	ECU-B fuse Generator L terminal Daytime running light relay Wire harness	BE-10 - BE-17 -

w/o Daytime Running Light System: HEADLIGHT AND TAILLIGHT SYSTEM

Symptom	Suspected Area	See page
	 HEAD fuse (LH, RH) Headlight control relay Headlight dimmer switch 	BE-10 BE-17 BE-17
Headlight does not light. (Taillight is normal.)	 4. Light control switch 5. Body ECU 6. Headlight bulb 7. Wire harness 	BE-17 BE-17 DI-768
Headlight does not light. (Taillight does not light up.)	1. HEAD fuse (LH, RH) 2. Headlight control relay 3. Headlight dimmer switch 4. Light control switch 5. Headlight bulb 6. Wire harness	BE-10 BE-17 BE-17 BE-17
Only one side light does not light.	HEAD fuse (LH, RH) Headlight bulb Wire harness	BE-10 - -
"Lo-beam" does not light. (All)	1. HEAD fuse (LH, RH) 2. Headlight dimmer switch 3. Headlight bulb 4. Wire harness	BE-10 BE-17 -
"Lo-beam" does not light. (One side)	HEAD fuse (LH, RH) Headlight bulb Wire harness	BE-10 - -
"Hi–beam" does not light. (All)	1. HEAD fuse (LH, RH) 2. Headlight dimmer switch 3. Headlight bulb 4. Wire harness	BE-10 BE-17 -
"Hi-beam" does not light. (One side)	1. HEAD fuse (LH, RH) 2. Headlight bulb 3. Wire harness	BE-10 - -
"Flash" does not light.	1. HEAD fuse (LH, RH) 2. Headlight dimmer switch 3. Headlight bulb 4. Wire harness	BE-10 BE-17 -
Headlight does not light with light control switch in HEAD.	Light control switch Wire harness	BE-17 -

2003 TOYOTA TACOMA (RM1002U)

Headlight does not go out with light control switch in OFF.	Light control switch Wire harness	BE-17 -
Taillight does not light with light control switch in TAIL.	 Taillight control relay TAIL fuse Light control switch Wire harness 	BE–17 BE–10 BE–17
Taillight does not go out with light control switch in OFF.	 Taillight control relay TAIL fuse Light control switch Wire harness 	BE-17 BE-10 BE-17

TURN SIGNAL AND HAZARD WARNING SYSTEM

Symptom	Suspected Area	See page
"Hazard" and "Turn" do not light up.	 Hazard warning switch Turn signal switch Wire harness 	BE-22 BE-22
The flashing frequency is abnormal.	Bulb Turn signal flasher relay Wire harness	BE-22
Hazard warning light does not light up. (Turn is normal.)	HORN. HAZ fuse Hazard warning switch Wire harness	BE-10 BE-22
Hazard warning light does not light up in one direction.	Hazard warning switch Wire harness	BE-22 -
Turn signal does not light up.	 TURN fuse Ignition switch Turn signal switch Wire harness 	BE-10 BE-14 BE-22
Turn signal does not light up in one direction.	Turn signal switch Wire harness	BE-22 -
Only one bulb does not light up.	Bulb Wire harness	- -

INTERIOR LIGHT SYSTEM

Symptom	Suspected Area	See page
	1. Bulb	_
	2. Personal light	BE-24
Personal light does not light up.	3. Body ECU	DI-768
	4. Wire harness	_
Room light does not light up.	1. Bulb	_
	2. Room light	BE-24
	3. Door courtesy switch	BE-24
	4. Body ECU	DI-768
	5. Wire harness	_

BACK-UP LIGHT SYSTEM

Symptom	Suspected Area	See page
	1. GAUGE fuse	BE-10
	2. Ignition switch	BE-14
Back-up light does not light up.	3. Back-up light switch	BE-27
	4. Bulb	_
	5. Wire harness	_

2003 TOYOTA TACOMA (RM1002U)

Back-up light remains always ON.	Back-up light switch (M/T) Park/Neutral position switch (A/T)	BE-27 AT-22 or AT-9, DI-482
	3. Wire harness	_
Only one light does not light up.	1. Bulb	-
	2. Wire harness	_

STOP LIGHT SYSTEM

Symptom	Suspected Area	See page
Stop light does not light up.	1. STOP fuse	BE-10
	2. Stop light switch	BE-29
	3. Bulb	_
	4. Wire harness	_
Stop light remains always ON.	 Stop light switch Wire harness 	BE-29 -
Only one light does not light up.	Bulb Wire harness	_ _

WIPER AND WASHER SYSTEM

Symptom	Suspected Area	See page
	1. WIPER fuse	BE-10
Winers and weekers do not energic	2. Ignition switch	BE-14
Wipers and washers do not operate.	3. Wiper and washer switch	BE-31
	4. Wire harness	_
	1. WIPER fuse	BE-10
	2. Wiper and washer switch	BE-31
Wiper does not operate.	3. Wiper motor	BE-31
	4. Wire harness	_
	1. WIPER fuse	BE-10
Washer does not operate.	2. Wiper and washer switch	BE-31
	3. Washer motor	BE-31
	4. Wire harness	_

Meter, Gauges and Illumination:

COMBINATION METER

Symptom	Suspected Area	See page
	1. GAUGE fuse	BE-10
Tachometer, fuel gauge and water temperature gauge do	2. Body ECU	DI-768
not operate.	3. Meter circuit	BE-37
	4. Wire harness	_
	1. Vehicle speed sensor	BE-39
Speedometer does not operate.	2. Meter circuit	BE-37
	3. Wire harness	_
	1. ECM 2RZ–FE, 3RZ–FE	DI-22
	5VZ-FE	DI-240
Tachamatar daga not anarata	2. Meter circuit	BE-37
Tachometer does not operate.	3. Wire harness	-
	4. Igniter	IG-1 or
		IG-1
	1. Fuel receiver gauge	BE-39
First record data and according to the control of t	2. Fuel sender gauge	BE-39
Fuel gauge does not operate or abnormal operation.	3. Meter circuit	BE-37
	4. Wire harness	_

2003 TOYOTA TACOMA (RM1002U)

	Engine coolant temperature receiver gauge Engine coolant temperature sender gauge	BE-39 BE-39
Engine coolant temperature gauge does not operate or abnormal operation.	3. ECM 2RZ-FE, 3RZ-FE 5VZ-FE	DI-22 DI-240
operation.	4. Meter circuit 5. Wire harness	BE-37
All illumination lights do not light up.	Light control rheostat Meter circuit Wire harness	BE-39 BE-37 -
Only one illumination light does not light up.	Bulb Meter circuit	– BE–37

Warning Lights: COMBINATION METER

Symptom	Suspected Area	See page
Warning lights do not light up. (Except discharge)	 Bulb GAUGE fuse Ignition switch Meter circuit Wire harness 	– BE–10 BE–14 BE–37
Low oil pressure warning light does not light up.	 Bulb Oil pressure warning switch Meter circuit Wire harness 	– BE–39 BE–37 –
Brake warning light does not light up.	 Bulb Brake fluid level warning switch Parking brake switch Meter circuit Wire harness 	– BE–39 BE–39 BE–37
Washer level warning light does not light up.	 Bulb Washer fluid level warning switch Meter circuit Wire Harness 	– BE–39 BE–37 –
Discharge warning light does not light up.	 IGN Fuse Bulb Wire harness Generator 	
Seat belt warning light does not light up.	 Bulb Seat belt buckle switch Body ECU Meter circuit Wire harness 	– BE–39 BE–37

Indicator Lights: COMBINATION METER

Symptom	Suspected Area	See page
SRS indicator light does not light up.	 Bulb Airbag sensor assembly Meter circuit Wire harness 	– DI–586 BE–37 –
ABS indicator light does not light up.	 Bulb ABS ECU Meter circuit Wire harness 	– DI–543 BE–37 –

2003 TOYOTA TACOMA (RM1002U)

	1. Bulb	_
Malfunction indicator light does not light up.	2. ECM 2RZ–FE, 3RZ–FE	DI-22
	5VZ-FE	DI-240
	3. Wire harness	-
	1. Bulb	-
Turn indicator light door not light up	2. Turn signal and hazard warning system	BE-2
Turn indicator light does not light up.	3. Meter circuit	BE-37
	4. Wire harness	-
	1. Bulb	_
High beam indicator light does not light up.	2. Headlight and taillight system	BE-2
Thigh boarn maloator light accorde light up.	3. Meter circuit	BE-37
	4. Wire harness	-
	1. Bulb	_
	2. Meter Circuit	BE-37
O/D OFF indicator light does not light up	3. ECM	AT–2 or
		DI-522
	4. Wire Harness	_
	1. Bulb	_
A/T OIL TEMP. indicator light does not light up	2. Meter Circuit	BE-37
7V1 OIL TEIVIII : Indicator light according to ap	3. ECM	DI-473
	4. Wire Harness	-
	1. Bulb	_
ECT PWR indicator light does not light up	2. Meter Circuit	BE-37
2011 With indicator light does not light up	3. Pattern select switch	DI-528
	4. Wire Harness	-
	1. Bulb	-
	2. Meter Circuit	BE-37
A/T P indicator light does not light up	3. ECM 2RZ–FE, 3RZ–FE	DI-22
	5VZ–FE	DI-240
	4. Wire Harness	_
Cruise control indicator lights do not light up	1. Bulb	_
	2. Meter Circuit	BE-37
	3. ECM (w/ ETCS)	DI-699
	4. Cruise ECU (w/o ETCS)	DI-728
	5. Wire Harness	_

POWER WINDOW CONTROL SYSTEM

Symptom	Suspected Area	See page
	1. ECU-IG fuse	BE-10
	2. Ignition switch	BE-10
	3. Power window master switch	BE-48
Power window does not operate.	4. Power window control switch	BE-48
	5. Power main relay	BE-48
	6. Body ECU	
	7. Wire harness	_
"One touch power window system" does not operate.	Power window master switch	BE-48
Only one window glass does not move.	Power window master switch	BE-48
	2. Power window control switch	BE-48
	3. Power window motor	BE-48
	4. Wire harness	_
"Window lock system" does not operate.	Power window master switch	BE-48
Illumination does not light up.	Power window master switch	BE-48

2003 TOYOTA TACOMA (RM1002U)

POWER DOOR LOCK CONTROL SYSTEM

Symptom	Suspected Area	See page
"Door lock control system" does not operate. (All)	ECU-IG fuse DOME fuse	BE-10 BE-10
	3. Body ECU4. Wire harness5. Other parts	DI–765 – –
Malfunction in door lock / unlock. (Using door manual switch.)	Door lock control switch Wire harness Other parts	BE-54 - -
Malfunction in door lock / unlock. (Using door manual switch and key.)	Wire harness Other parts	<u> </u>
Malfunction in door lock / unlock. (Using key.)	 Door key lock and unlock warning switch Door unlock detection switch Wire harness Other parts 	BE-54 - -
Fault in 2 – operation unlock function of driver's side door key lock and unlock switch.	 Door key lock and unlock warning switch Door unlock detection switch Wire harness Other parts 	BE-54 - -
Fault in key confine prevention operation.	 Door unlock detection switch Door courtesy switch Door lock control switch Wire harness Other parts 	BE-54 BE-24 BE-54 -
Only one door lock does not operate.	Door lock motor Wire harness	BE-54 -

POWER SEAT CONTROL SYSTEM

	Power seat switch (Lumber support switch)	BE-59
Lumbar support operation does not operate.	2. Lumbar support motor	BE-59
	3. wire Harness	_

POWER MIRROR CONTROL SYSTEM

Symptom	Suspected Area	See page
Mirror does not operate.	1. ACC fuse	BE-10
	2. Mirror switch	BE-62
	3. Mirror motor	BE-62
Mirror operates abnormally.	1. Mirror switch	BE-62
	2. Mirror motor	BE-62
	3. Wire harness	_

CLOCK SYSTEM

Symptom	Suspected Area	See page
Clock will not operate.	TROUBLESHOOTING NO. 1	BE-99
Clock loses or gains time.	TROUBLESHOOTING NO. 2	BE-99

HORN SYSTEM

Symptom	Suspected Area	See page
Horn system does not operate.	1. HORN. HAZ fuse	BE-10
	2. Horn switch	
	3. Horn	
	4. Body ECU	
	5. Wire harness	-

2003 TOYOTA TACOMA (RM1002U)

BODY ELECTRICAL – TROUBLESHOOTING

Horns blow all the time.	Horn switch Wire harness	BE-102 -
One horn operates but the other horn does not operate.	Horn Wire harness	BE-102 -
Horns operate abnormally.	Horn Wire harness	BE-102 -