DI191-24

# SRS Warning Light Circuit Malfunction (Does not light up, when ignition switch is turned to ON.)

# CIRCUIT DESCRIPTION

The SRS warning light is located on the combination meter.

When the SRS is normal, the SRS warning light lights up for approx. 6 seconds after the ignition switch is turned from LOCK position to ON position, and then turns OFF automatically.

If there is a malfunction in the SRS, the SRS warning light lights up to inform the driver of the abnormality. When terminals Tc and CG of the DLC3 are connected, the DTC is displayed by blinking the SRS warning light.


# **WIRING DIAGRAM**

See page DI-678.

1

# **INSPECTION PROCEDURE**

Check ECU-B Fuse.

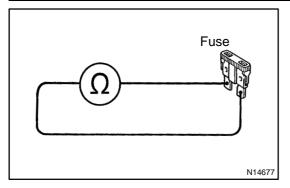

#### **PREPARATION:**

Remove ECU-B fuse.

### **CHECK:**

Check continuity of ECU-B fuse.

#### OK:

# Continuity

#### HINT:

- Fuse may be burnt out even if it appears to be OK during visual inspection.
- If fuse is OK, install it.



ОК

2


Prepare for inspection. (See step 1 on page DI-675)

2003 TOYOTA TACOMA (RM1002U)

Author: Date:

942

# Check SRS warning light circuit.

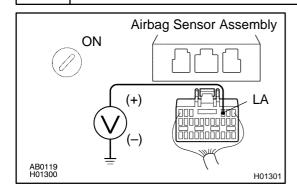

# **PREPARATION:**

- (a) Connect negative (-) terminal cable to the battery.
- (b) Turn ignition switch to ON.

# **CHECK:**

Measure the voltage between LA terminal of the harness side connector and body ground.

# OK:

Voltage: 0 V

SRS warning light: Light up



Check SRS warning light bulb or repair SRS warning light circuit.




3

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 943

4

# Does SRS warning light come on?

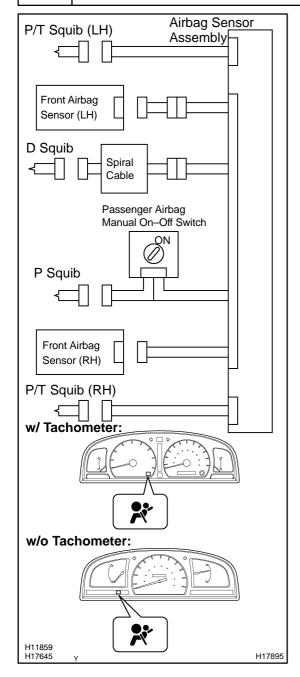

#### **PREPARATION:**

- (a) Disconnect negative (–) terminal cable from the battery.
- (b) Connect the airbag sensor assembly connector.
- (c) Connect negative (–) terminal cable to the battery, and wait at least for 2 seconds.
- (d) Turn ignition switch to ON.

#### **CHECK:**

Check operation of SRS warning light.

NO

Check terminal LA of airbag sensor assembly. If normal, replace airbag sensor assembly.



From the results of the above inspection, the malfunctioning part can now be considered normal. To make sure of this, use simulation method to check.

2003 TOYOTA TACOMA (RM1002U)

Author: Date:

944

5 Is new SRS fuse burnt out again?

NO

Using simulation method, reproduce malfunction symptoms. (See page IN-18)

**YES** 

Check harness between SRS fuse and SRS warning light.

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 945