
ANTI-LOCK BRAKE SYSTEM

HOW TO PROCEED WITH TROUBLESHOOTING

DI051-23

Troubleshooting in accordance with the procedure on the following pages.

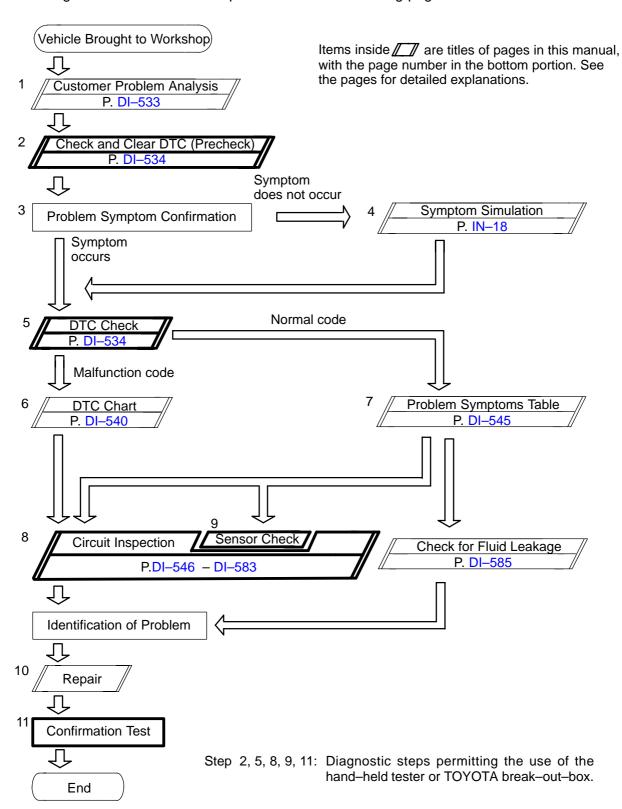

Fail safe function:

When a failure occurs in the ABS system, the ABS warning light is lit and the ABS operation is prohibited.

2003 TOYOTA TACOMA (RM1002U)

Author: Date:

794