
RS02B-04

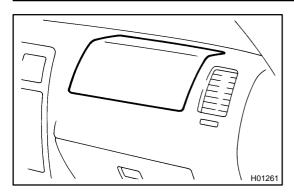


INSPECTION

1. VEHICLE NOT INVOLVED IN COLLISION


- (a) Do a diagnostic system check (See page DI-588).
- (b) Do a visual check which includes the following items with the front passenger airbag assembly installed in the vehicle.

Check for cuts, minute cracks or marked discoloration of the front passenger airbag door.

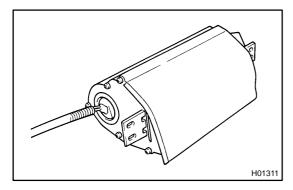


2. VEHICLE INVOLVED IN COLLISION AND AIRBAG IS NOT DEPLOYED

- (a) Do a diagnostic system check (See page DI-588).
- (b) Do a visual check which includes the following items with the front passenger airbag assembly removed from the vehicle.
 - Check for cuts and cracks in, or marked discoloration of the front passenger airbag door.
 - Check for cuts and cracks in wire harnesses, and for chipping in connectors.
 - Check for deformation of the instrument panel and instrument panel reinforcement.

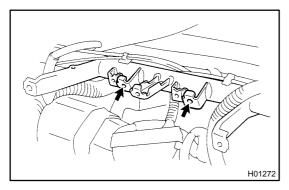

HINT:

If the instrument panel or instrument panel reinforcement is deformed, never repair it. Always replace it with a new one.

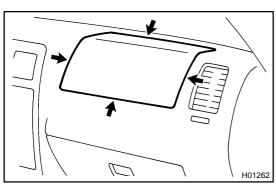

There should be no interference between the instrument panel and front passenger airbag door, or the glove compartment door and front passenger airbag door. The clearance should be uniform all the way around when the new airbag assembly is installed on the instrument panel.

CAUTION:

For removal and installation of the front passenger airbag assembly, see page RS-25 and RS-35 and be sure to follow the correct procedure.

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 2244

3. VEHICLE INVOLVED IN COLLISION AND AIRBAG IS DEPLOYED

- (a) Do a diagnostic system check. (See page DI-588)
- (b) Do a visual check which includes the following items with the airbag assembly removed from the vehicle.
 - Check for deformation of the instrument panel, instrument panel reinforcement and glove compartment door.
 - Check for damage to the connector and wire harness.

HINT:

- If the instrument panel or instrument panel reinforcement is deformed, never repair it. Always replace it with a new one.
- There should be no interference between the instrument panel and front passenger airbag door, or the glove compartment and front passenger airbag door. The clearance should be uniform all the way around when the new airbag assembly is installed on the instrument panel.

Author: Date: 2245