

RS01N-32

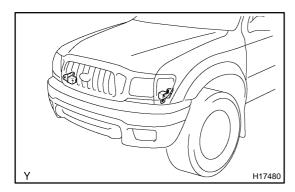

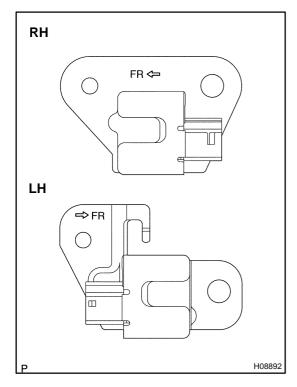

INSPECTION

1. VEHICLES NOT INVOLVED IN COLLISION

Do a diagnostic system check.

(See page DI-588)

2. VEHICLES INVOLVED IN COLLISION

- (a) Do a diagnostic system check (See page DI-588).
- (b) If the front fender of the car or its periphery is damaged, do a visual check for damage to the front airbag sensor, which includes the following items even if the airbag was not deployed:
 - Bracket deformation
 - Paint peeling off the bracket
 - Cracks, dents or chips in the case
 - Cracks, dents, chipping and scratches in the connector
 - Peeling off of the label or damage to the serial number

2003 TOYOTA TACOMA (RM1002U)

Author: Date: 2261